



Management Cloud Release Notes

Build 1.5.4

August 21 2023

Contents

Contents	1
Management Cloud 1.5.4 Overview	2
Management Cloud System Requirements	8
CER Fixes in 1.5.4.....	8
Known Issues.....	9
For More Information.....	11
Appendix 1: History of Feature Additions By Version.....	12
Appendix 2: History of CER Fixes By Build.....	16

Management Cloud 1.5.4 Overview

The 1.5.4 maintenance release includes:


- See “CER Fixes in 1.5.4”

The 1.5.2 maintenance release includes:


- See “CER Fixes in 1.5.2”

The 1.5.1 software release includes:

- **Cross-Platform Application**
 - Management Cloud application support for Windows and now for MacOS*.

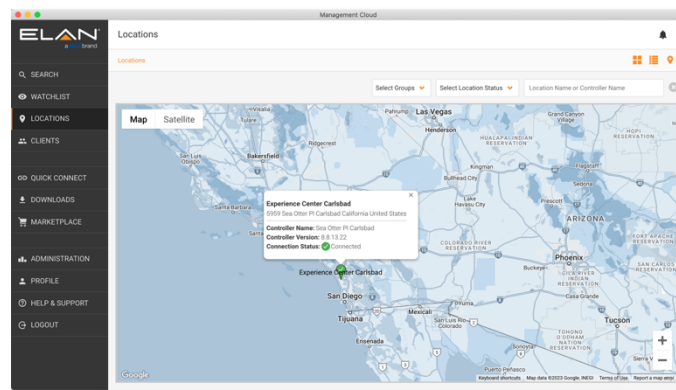


- **ELAN 8.8 Support**
 - **Configurator v2 Support*:**
 - Support for all-new, cross-platform Configurator v2 (aka Config v2) based on our proven thin client architecture. Note: Configurator (Classic, aka Config v1) will continue to be available for Windows systems only.

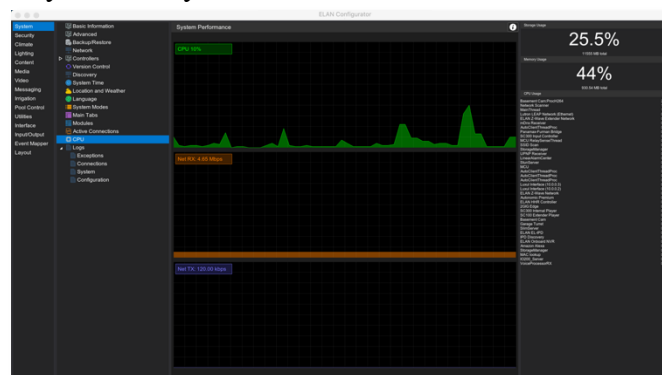


- **OTA Version Control*:**

- Update ELAN controllers quickly and safely using our OTA (Over-the-Air) updated workflow. Navigate into a location, click on the update icon, select your desired version and off it goes.
 - See “Management Cloud OTA Version Control” Section below for details
- **Native BlueBOLT Support**
 - Leverage BlueBOLT infrastructure to manage your BlueBOLT-enabled devices in Management Cloud, keeping all your device control in a single interface. Common use case would be to use a BlueBOLT device manage power to your ELAN controller, where “Powerlinked” devices are managed by the controller. But all devices in a location can be power managed by BlueBOLT devices added to Management Cloud.
 - How to Add: In a location, just select “Add Device” from the upper right overflow menu (three vertical dots).
 - Scheduled Commands not yet supported in Management Cloud, but functionality soon be covered in cloud-based events feature.
 - Note: At this time, a device cannot be claimed in mybluebolt.com and Management Cloud simultaneously. If you wish to move your device to Management Cloud, delete it from mybluebolt.com, then claim in Management Cloud.

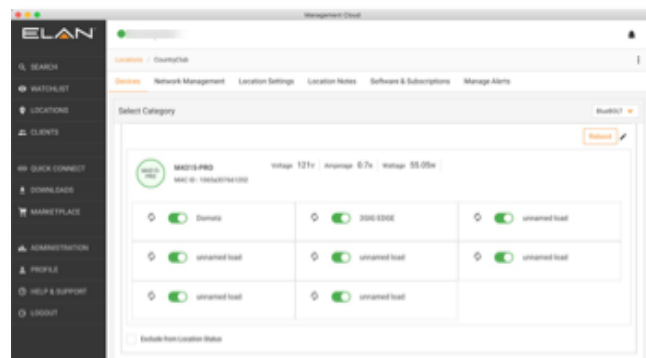


- **Powerlink Support**
 - Powerlink associations made in ELAN Configurator will now expose power controls (On/Off/Cycle) for that device in its Management Cloud location, giving you more control to detect and resolve issues from a single interface.

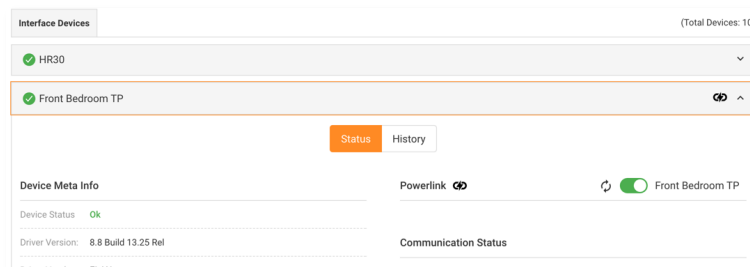


- **Search & Filters**
 - **Documentation Advanced Search**



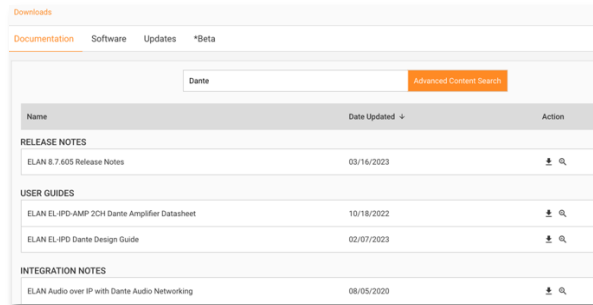










- Documentation tab now features the same advanced content searching function found in Global Search (upper left of application). Search thousands of documents by their content, not just their title or category as before.



- **Video Notes Filter**
 - tab now includes a name/description filter to help you find your topic of interest more quickly. Video Notes are also now searchable in Global Search.
- **Global Search**
 - Global Search (top left of application) will continue to evolve to find all docs, Help & Support content, clients, locations, devices/drivers in locations, Marketplace listings.
- **Significant Performance Improvements**
 - Location and Device Status performance improvements ensure more immediate updates, closely matching status updates on your controllers and the devices attached. The update provides faster access to Viewer, Configurator, Configurator v2 and the new OTA buttons in a location, even on larger systems with a lot of devices.
- **General UI/UX Improvements**
 - **New Status Icons:**
 - Status icons have been updated for improved accessibility, based on user feedback.



- **Locations List & Card View Updates:**
 - In Locations List & Card View, you can now launch Configurator (large gear icon), Configurator v2 (two gear icons) and Viewer (touchpanel icon) from the Actions column, based on the controller configuration in your Location. Saving time & taps!

Integrations	Last Firmware Update Date	↑	Actions
	03/22/2023 1:52:49 PM		    
 	03/22/2023 1:51:15 PM		    


- **Device History:**

- Accessed when opening a device tab in your location, Device History gives you the last week of device status updates, useful in troubleshooting.

Video (Total Devices: 8)		
Living Room		
Status History		
Date - Time	On Status Change	Device Status String
03/21/2023 12:06:46 PM	GREEN	Ok
03/21/2023 12:06:34 PM	RED	Disconnected

- **Manage Notifications Update:**


- Notifications are important updates from Nice/ELAN, and now include an email option so you'll never miss a message.
 - Profile > Manage Notifications.

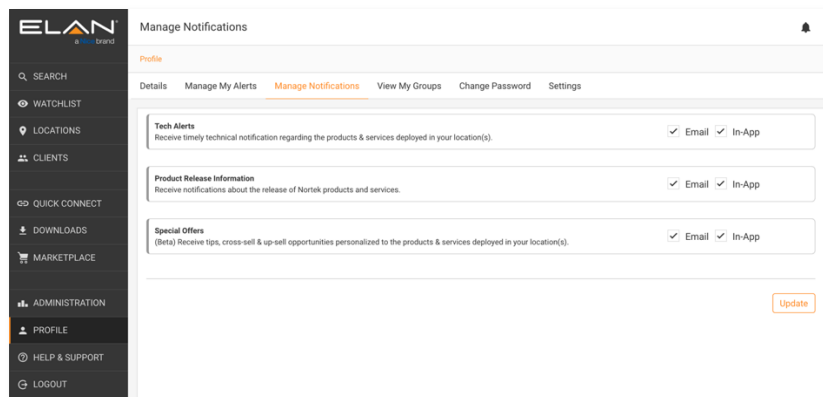

- **Marketplace**

- **New Releases:**

- New Releases section so you can quickly find the latest additions to the ELAN ecosystem.

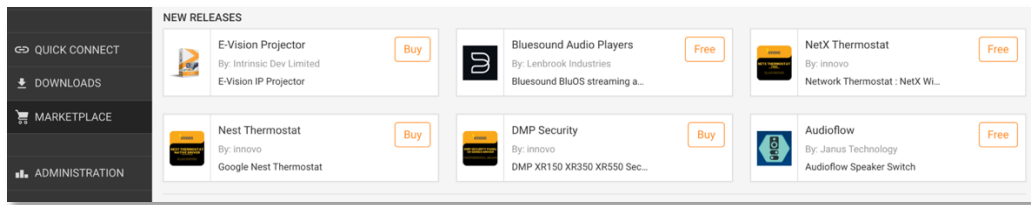

*Controller must be running Core OS 8.8 and later. The Core OS 8.8 installer is only available for Windows. Please update controllers from a Windows machine and subsequent updates can be done with Management Cloud 1.5 and later, on Windows and MacOS. Configurator (Classic, aka Config v1) is only available on Windows.

It is imperative that Installers retain access to a Windows PC, or PC emulator on Mac, for running Windows executable installers as necessary, and for restoring Configurator (Classic, aka Config v1) .ebk backup files, during this transition to cross-platform configuration and Over-the-Air (OTA) controller updates.

Management Cloud OTA Version Control


Over-The-Air (OTA) ELAN Controller Updates are faster than the traditional Windows executable update and can be performed locally or remotely via Management Cloud for Windows and MacOS.

Your controller must be running Core 8.8 build or later, and you must be using Management Cloud 1.5 or later to access this function. Just go to your location in Management Cloud, and next to the current core version listed for your controller, click on the cloud download icon to see your version control options.

If you have extenders attached, you will be prompted to optionally include those in the update routine. ***As with all installation, performing a local backup first is recommended.*** We will be offering a cloud backup & restore option as part of the OTA Version Control workflow later this year.

Management Cloud initiates OTA updates, but the controller(s) download the update, install and reboot, so bandwidth for OTA is primarily dictated by your controllers' network. This means you can initiate the update in Management Cloud and then close the dialog and do other tasks as the updates continue. Refresh the Location to see version and status update when controller comes back online.

It is imperative that Installers retain access to a Windows PC, or PC emulator on Mac, for running Windows executable installers as necessary, and for restoring Configurator (Classic) .ebk backup files, during this transition to cross-platform configuration and Over-the-Air (OTA) controller updates.

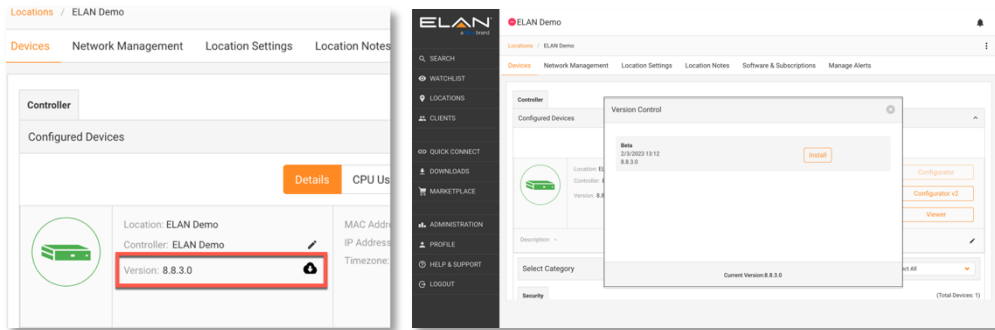

OTA VERSION CONTROL IN MANAGEMENT CLOUD 1.5

Please see Management Cloud 1.5 Release Notes for other feature updates

Note:

Controllers must be running **ELAN core release 8.8 or later** to utilize Configurator v2, OTA Version Control and related features.

Controllers must be running **ELAN core release 8.3.11 or later** when adding as a Location in Management Cloud. The **Quick Connect** function in Management Cloud is not dependent on the core release version running on the controller.

Management Cloud System Requirements

- Stratus Application
 - PC running Windows 10
 - 128MB RAM
 - 1GB free disk space (complete library download)
- ELAN Core software 8.3.11 or later is required for controllers added as locations in Management Cloud.

CER Fixes in 1.5.4

Fixes in 1.5.4 (August 2023)

- CC001-4772 App crash when adding location or client (Google Map API)

Fixes in 1.5.2 (June 2023)

- CC001-4661 OTA Release slot propagation issue

Fixes in 1.5.1 (June 2023)

- CC001-4498 Management Cloud: Apply "Autonomic Premium" License
- CC001-4497 Management Cloud : Device Status refactoring to greatly speed access to OTA, Viewer, Configurator buttons, especially on large systems.
- CC001-4403 Management Cloud: Global Search now Includes Video Notes
- CC001-4518 Management Cloud: OTA updates with Extenders should have checkboxes checked by default
- CC001-4331 Management Cloud : Smarter cursor placement on Login Screen

Known Issues

- **Management Cloud 1.5 Installer for MacOS**
 - **The Management Cloud 1.5 Installer has not yet received Notarization authorization from Apple, so there are some steps to get the app installed in the meantime**
 - Note for Newer MacOS version:
 - Control key needs to be held down while clicking on the application. When you do this the option to Open the app is available.
 - On Older MacOS versions:
 - Download and Open .dmg installer on your MacOS device
 - Drag Management Cloud app icon to the Application folder icon to copy it to your system
 - Navigate to your Applications folder and launch Management Cloud
 - *Note for Newer MacOS versions:* Clicking on the app may not launch the app. Control key needs to be held down while clicking on the application. When you do this the option to Open the app is available.
 - You will get an error: “Management Cloud.app” can’t be opened because Apple cannot check it for malicious software.”
 - Quit app
 - Go to MacOS Settings > Security & Privacy
 - On the General tab there will be reference to blocked app. Click “Open Anyway”
 - You will see another warning: “Management Cloud.app” can’t be opened because Apple cannot check it for malicious software.”
 - Click “Open”
 - Subsequent launches of the application should be without errors/warnings.
- **Management Cloud 1.5 > Downloads > Check for Updates**
 - This feature not enabled on this Mac version, will always return a message that the latest version is installed. Please look for downloadable installers on the Downloads tab.
- **Profile > Settings**

- This version supports English only
- **Alerts**
 - Devices that exist in multiple subsystems (e.g. ITP, ELAN doorbell) default to sending alerts for each instance of the device. Alerts for these types of devices will be consolidated in future build but in meantime you can adjust alerts as desired per device instance.
- **System Logs**
 - There is no date/time selector in System Logs section of Management Cloud so initial access will only show current logs presented by the controller

For More Information

<https://elancontrolsystems.com/elan-management-cloud/>

Management Cloud page on the ELAN website includes

- Apply for Management Cloud Account
 - Authorized ELAN Dealers & Distributors and ELAN API Partners only
- Management Cloud Installer*
- Management Cloud Release Notes*
- Management Cloud User Guide*
- Management Cloud Service Status

* Also located in the Downloads tab in the Management Cloud application

Appendix 1: History of Feature Additions By Version

The 1.4.10 software release includes:

- Fixes and Enhancements listed in the “CER Fixes in 1.4.10” of this document

The 1.4.9 software release includes:

- Support for multiple EL-SW-NVR licenses (Onboard/Extender). Feature requires ELAN Core OS 8.7.501 and later.
- Marketplace: New Releases section
- Reporting & Analytics Update (Beta Access only)

The 1.4.25 (April 14) software release includes:

- Support for ELAN Utilities (8.7)
- Native BlueBolt device claiming & support (Beta Access Only)
- Fixes and Enhancements. See CER section in this document.

The 1.4.4 (Feb 2022) software release included:

- Minor User Interface Updates
- Fixes and Enhancements. See CER section in this document.

The 1.3.0 (April 2021) software release included:

- **Marketplace**
 - ELAN 3rd party drivers can now be browsed/searched in Management Cloud.
 - Use the Global Search option (upper left of app) to search for drivers by name, description, subsystem, developer name.
 - Use the filter at the top of Marketplace to quickly find driver by name, developer name, category.
 - Sort pulldown to switch between category or developer grouping order
- **Location Creation/Update Changes**
 - **Create Location without Controller** allows you to proactively create a location before an installation. If ELAN controller is not planned for a location, you can still create a location, clients, notes as desired. Easing the requirement for an ELAN controller in a location paves way for other integrations.
 - **Remove/Replace a Controller** in a location to manage controller in case of RMA or upgrade without having to create a new location from scratch, losing historical data.
- **Documentation Subcategories**

- To aid in browsing, especially for integration notes, documents can be grouped by subcategory (subsystem in the ELAN context, e.g: Irrigation)
- Filter at the top of the Documentation screen will also work for subcategories.
- **Reporting & Analytics (beta)**
 - **User Audit Report** will allow Owners and Tech Leads to run a report on their company's Management Cloud users, tracking activity in the platform.
 - Activities shown include log-in/log-out; add/update/delete location; add/update delete client; add/update/delete notes; add/update/delete groups; rename controller; download document/software; launch configurator/viewer.
- **General Improvements**
 - List View added to Watchlist
 - Management Cloud installer signed
 - Tab, section and field label improvements

The 1.2.0 (Oct 2020) software release included:

- **License Management**
 - Support for EL-SW-100-PRO license.
 - Required SC-100 running 8.5.9 or later
- **Help Center Tab**
 - Located in Help & Support tab, the new Help Center provides access to product information including data sheet, install guides and other technical information
- **Group Overlap**
 - Groups expanded to allow same location and user to exist in multiple groups, giving more flexibility into how groups can be used and assigned.
- **Beta Tab**
 - Beta tab in Downloads area to deliver docs & downloads for those in the ELAN beta program. Beta program is by invitation only and this tab will not be present if not enrolled in program.
- **Enhancements**
 - Improved Global Search
 - Editable Latitude and Longitude values for Location
 - Values can be entered manually or overwritten on Location Settings tab. Useful in cases where Google Map API cannot find an entered address
 - Company Logo
 - Your Company Logo and Address now editable in the Administration tab
 - Emails
 - Reminder Emails for account completion sent every 24 hours, up to 3 days, or until accepted
 - Improved navigation for Location and Client cards
 - General
 - App Version number to login screen
 - Controller renaming restrictions eased to match Tech Support tool

The 1.1.1 software release included:

- **License Management**
 - New “Software & Subscriptions” tab in Locations
 - Lists gVSL license installed on a Location’s ELAN Controller
 - If license not present, option to apply gVSL license code from within the Management Cloud application.
 - **Note:** Controllers must be running ELAN core release 8.4.96 or later to apply a gVSL license within Management Cloud.
- **Performance Improvements**
 - Faster location loading, up to 1000+ locations
 - Improved Global Search
- **Enhancements**
 - All Locations Filter
 - Quickly Filter Locations by Location or Controller Name, Location Status, Group association or combination thereof.
 - Default Landing Page
 - In your profile settings, choose between Watchlist and Quick Connect as your default landing page when you log in.
 - Emails
 - Reformatted email header provides device status
 - Unsubscribe link in Alert emails
- **Fixes**
 - See “CER Fixes” section of this document

The 1.0.5 software release included:

- **Performance Improvements**
 - All Locations, Watchlist, Quick Connect, Clients, Clients Location screens

The 1.0.4 software release included:

- **Location Views Updates**
 - List View sorting, formatting and navigational improvements
 - View Selection and sort order are now remembered
 - Default Zoom on Map View now relevant to locations
- **Quick Connect**
 - Saved Controllers: Enhancements to better handle saving HC controllers and controllers without saving password.
- **Search**
 - Global search now includes Device Type and Driver names
- **Alerts**
 - Email alerts subject change to better see location/device in preview
- **Application**

- Application updates are now a foreground activity, making update status clearer to user.
- **Fixes and Enhancements**
 - See “CER Fixes” section of this document

The 1.0.3 software release included:

- **Login Page, Icon Redesign**
- **Application Form and Account Workflow improvements**
- **Manage My Alerts**
 - New Bulk updating for On State Change, Alert Mode, Alert Threshold is available in this tab via the Column Editor at the top of each location.
- **Saved Pagination Settings**
 - Tabs with “Rows” pulldown now retain last selection
- **Quick Connect Notes**
 - One can now add notes to Saved Controller in Quick Connect tab. These notes are indexed and searchable in the search field at the top of the screen.
- **Application Upgrade Improvements**
 - Application update notifications and installation—suggested and forced—are now done in the foreground so progress is seen.
- **Dozens of Fixes and Enhancements**
 - See “CER Fixes” section of this document

The 1.0.2 software release included:

- **Alert Default Settings**
 - Default Alert settings can now be set in Profile > Settings, including On State Change, Alert Mode and Threshold.
 - “Default Alert Settings” to your alert settings when you are added to a location, such as when you create a location, added to a location as a member of an Admin Group or manually added via the “Add Recipient To All” and “Add Alert Recipient” on the Manage Alerts tab.
 - Default Alert Settings updated to:
 - On State Change = Green | unchecked
 - Alert Mode = E-Mail | unchecked
- **Alert Threshold**
 - Additional thresholds added: +30, +60, +90 minutes
- **Address Lookup Function**
 - “Search Address...” field added to applicable areas of application to suggest addresses to speed entry and pin placement accuracy on Location map.
 - NOTE: Client and Client Contact addresses entered without the Search function may result in inaccurate map placement. Existing client records can be updated and saved using this function.
- **Note Formatting**
 - Note formatting improvements
 - Duration Calculation

- **Downloads Improvements**
 - “View” option for Documentation to open PDFs from within application
 - Column sort options added
- **Notifications**
 - Notifications enabled
 - Auto-mark as read
- **Software Update Functions**
 - Update Available Function
- **Dozens of Fixes and Enhancements**
 - See “CER Fixes” section of this document

The 1.0.1 software release included:

- **Alert Threshold**
 - Refine in-app and email alert frequency by customizing threshold on a per-component basis. Reduce alerts for oscillating devices.
 - Select from 0 (no threshold), +3, +5, +10, +15 minutes
- **Address Lookup Function**
 - “Search Address...” field added to applicable areas of application to suggest addresses to speed entry and accuracy.
- **Note Categories**
 - Note Categories can be defined by Admins and accessed by employees in the Location Notes section of each location to help classify work performed. This will help standardize entries for forthcoming reporting functions.

Appendix 2: History of CER Fixes By Build

Fixes added in 1.4.10 (June 15 2022)

- CC001-4278 The update mechanism, found on Downloads > Software > Updates, in Management Cloud 1.4.9 is not currently working. This is fixed in 1.4.10 so users on 1.4.9 will need to manually download the next installer, found in Management Cloud: Downloads > Software.
- CC001-4277 Help Center not loading. Tab temporarily hidden

Fixes added in 1.4.9 (June 15 2022)

- CC001-4183 Forgot Password link gives unsecure browser message that must be bypassed
- CC001-4182 CV1/CV2 interface representation for claimed BlueBOLT devices*
- CC001-4224 User Audit Report corrections
- CC001-4169 Improved Time Zone Sync with BlueBOLT devices*
- CC001-3539 Quick Connect: Saving will no longer remove controller from active Controller Access window.
- CC001-3853 Needle exceeds Rx values in CPU graph

* BlueBOLT integration for Beta customers only

Fixes added in 1.4.8 (April 2022)

- CC001-4065: Quick Connect > Local Controllers: Slider bar to allow viewing of extended list of scanned controllers

Fixes added in 1.4.4 (Feb 2022)

- CC001-3536 Cannot Add Controller from Deleted Location
- CC001-3501 Software & Subscription Sync will readd missing license on controller when visiting tab
- CC001-3577 License key for SC100 getting applied for GVSL ,does not show any validation error message
- CC001-3625 Help Centre tab not loading on Production
- CC001-3724 Onboard NVR license Support
- CC001-3822 Better handling empty MAC address sent by controller

Fixes added in 1.3.0 (April 2021):

- CC001-3267 Help & Support: Tech Alert default sort by Date
- CC001-3337 Beta Tab, default sort by Date
- CC001-3240 Client email not indexed in Global Search
- CC001-3239 Client addresses not indexed in Global Search
- CC001-3072 No Data messaging improvements
- CC001-2527 IP Address sorting fix on Network tab

Fixes added in 1.2.0 (Oct 2020):

- CC001-3139 All locations API performance improvements
- CC001-3125 Updated Error message shown on the Software and Subscription tab when controller is offline
- CC001-3113 gVSL count shown as Unknown on some SC100 controllers

- CC001-3091 Controller naming restrictions eased to match Tech Support tool restrictions
- CC001-3078 When we visit the Software and Subscription with unknown license installed, it does not show it in list for very 1st time..
- CC001-2980 Tool Tip improvement for Lat/Lon
- CC001-2959 System Permission for accessing Groups (in Admin) affecting accessing groups in All Locations
- CC001-2958 Location Details >>Manage Alert , Configured devices taking more than 5 sec to load with 100+ devices
- CC001-2953 Download Doc and PDF viewing improvements
- CC001-2949 Tech Alert API improvements
- CC001-2944 Default image, initials, for Company logo
- CC001-2936 Inconsistent performance with Update button on Location settings
- CC001-2908 FE: Company logo edit and update
- CC001-2881 Global Search Improvement
- CC001-2880 Email Alert: Unsubscribe link leads to 404
- CC001-2879 Few pages are taking time to load Subsystem alert and on controller details page
- CC001-2878 [Client] Tapping on Show Contact info on client card does not shows contact info
- CC001-2868 Download Display date off in application
- CC001-2818 [Intermittent]The subsystem alert api on Manage My Alert screen takes time to load around 10 sec
- CC001-2817 [Group][User][Report & Analytics] The pagination set rows state is not maintain if we change to other tabs.
- CC001-2815 The Exclude Device took a long to check or unchecked on Controller Details page
- CC001-2814 [Location Health API] Faster location health update when controller offline.
- CC001-2757 Location Details > Manage Alerts, page takes around 5 sec for loading the page for 100+ devices
- CC001-2751 FE: Performance Improvement for Users tab
- CC001-2750 FE: Performance Improvement for Groups tab
- CC001-2743 BE API- Performance improvement for all clients api
- CC001-2739 BE - API Performance improvement for Download Documents
- CC001-2735 Login Screen: Change "Remember Me" to "Save Username"
- CC001-2659 Improved Client Card Navigation
- CC001-2631 Correct direction of Expand / Collapse arrows
- CC001-2514 [Clients] All Clients tab List View state not persisting the after switching navigating to other tabs
- CC001-2512 Add App Version number to login screen
- CC001-2438 Application Page: Footer update
- CC001-1224 Network Management Screen updates
- CC001-1196 All Clients: Contact Info overlay: Incorrect Icon

Fixes added in 1.0.5

- CC001-2720 All locations pagination set rows state is not maintained
- CC001-2731 Performance improvements for Location Health
- CC001-2749 Performance improvements for All Clients
- CC001-2747 Handle of 404 error on client image
- CC001-2744 API Performance improvement for STUN Request timeout
- CC001-2742 Performance improvement for Manage My Alerts
- CC001-2726 All Location Health API with caching improvements
- CC001-2786 Search performance improvements

Fixes added in 1.0.5

- CC001-2642 Performance Problems when many (100+) locations in account
- CC001-2664 All Location Performance improvement
- CC001-2671 Optimize calls on All Locations, Watchlist, Quick Connect, Clients, Clients Location
- CC001-2670 Allow card click navigation when location cards are loading

Fixes added in 1.0.4

- CC001-2341- Application goes blank when trying to open it after minimizing it.
- CC001-2442- Validation error when trying to save local controller
- CC001-2500 - Saved Controller remember password functionality fix.
- CC001-2505 - The Client card address truncation
- CC001-2508 - The Last Firmware Update Date sort fix
- CC001-2509 - Saved Controller pagination fix
- CC001-2518 - The App becomes blank while accessing the Watchlist.
- CC001-2521 - User can get stuck on the All Locations screen.

Fixes added in 1.0.3

- CC001-1877 Location Mute queues the alerts when it shouldn't
- CC001-1821 Create New Client, Entered State value is overwritten/saved with City value
- CC001-2344 Update note field> Mandatory field validation is display though it is a optional field
- CC001-2341 Application going blank when trying to open it after minimizing it.
- CC001-2205 Extra backslash(\) display along with underscore(_) into the client name
- CC001-2175 Remove "Alert Modes" from "Add Recipient to All" and "Add Alert Recipient to This Device" Dialogs

- CC001-1945 Save Pagination Settings on Quick Connect Tab
- CC001-1917 Download Software should have sortable filter columns as does Documentation page
- CC001-1875 Cannot save email that uses underscore
- CC001-1828 Profile > Manage Alerts Improvements
- CC001-606 Login Page Redesign
- CC001-2224 Profile > Update button is not enabled if user try to update only Default Alert Settings
- CC001-1794 Client Image Warning message rewrite
- CC001-1263 Location Card: Address overflows in UI
- CC001-2333 Default note category not populated in frontend application while created new company from application form
- CC001-2346 Cannot Add location with Dealer name that contains "&"

Fixes added in 1.0.2

- CC001-2172 Cannot add Recipient in the list once deleted from device
- CC001-2138 Map distorted when two controllers have same location
- CC001-2131 Removing alerts and notification counter is taking time when marked as read
- CC001-2130 Wrong messages on Mark as read for Alerts and Notifications
- CC001-2123 When note categories are bigger in length text is pushed to second line
- CC001-2094 Postal Code Validation too strict
- CC001-2074 Map Pins not using Client Contact address, still using controller Lat/Lon
- CC001-2068 Add Recipient to All: Add User Pulldown
- CC001-2055 User Email has broken verification link
- CC001-2044 User able to update time tracking details when start time is greater than the end time
- CC001-2037 The recently created note is added to the end of the list
- CC001-2029 Profile > View My Groups> Group name text overlap with the location name.
- CC001-2020 Reformat Note List
- CC001-2015 In-App navigation not working
- CC001-1992 Create Location > Select Client pulldown should be alphabetical
- CC001-1972 Time Format Not Followed in Notes
- CC001-1905 Force app upgrade function
- CC001-1889 Downloads Documentation section "MISCELLANOUS" is misspelled
- CC001-1877 Location Mute queues the alerts when it should purge them
- CC001-1820 Default Configured Devices Alerts & Threshold in Profile Setting
- CC001-1819 Location> Add Location>Client details: User is not able to add location when first checked 'Add new Client' checkbox and then select 'select Existing client' checkbox.

- CC001-1827 Add User > Location Permission rename to "Default Location Permission"
- CC001-1375 Notification - Auto Mark As Read
- CC001-2098 Cannot Delete Users from Location
- CC001-2167 Error adding location with double byte characters devices/names (utf8 double byte support)

Fixes added in 1.0.1

- CC001-946 Add Location: User unable to add any location if any group is not associated with it
- CC001-686 Client Contacts table which is now sortable by column does not have default sort selected and no indication table is sortable
- CC001-423 Location Settings: Select different contact would not update with appropriate address in Client Info area
- CC001-2033 Navigation from search is not working
- CC001-2029 Profile > View My Groups> Group name text overlap with the location name.
- CC001-2015 In-app navigation not working when clicking on alert
- CC001-1895 Connected Devices should not have Alert Modes enabled by Default
- CC001-1870 Save Controller display limit of 10 controllers
- CC001-1570 Cannot Delete location if Controller or Stratus User on Controller not available
- CC001-1548 Communication Status Table layout issues
- CC001-1522 Client Contact: Getting error "Precondition failed" when we try to delete primary contact
- CC001-1510 Delete Last note remove the note from list but leave note contents on screen
- CC001-1503 Changing Contact in Locations settings passes when you update but does not save the change and reverts back to original contact
- CC001-1501 Deleting Client Contacts that is used in a location as a Primary Contact fails with error "Pre-condition failed"
- CC001-1498 View group: Alignment issue on view group page
- CC001-1490 Create new client: finish button is not getting disabled even mandatory field "time zone " is not selected
- CC001-1477 Center Alert/Notification Counts in circle
- CC001-1466 Search panel not closing after selecting a result
- CC001-1446 Manage Alerts Screen: Subsystem & device text positioning
- CC001-1436 Location Note: Note text is overflowing for large text
- CC001-1409 Add Location Client Details page will allow leading spaces in any of the fields but also saves them with the spaces
- CC001-1261 Address overflow issues